

Test Report No. SDFS2006003249FF Date: Jun.16, 2020 Page 1 of 2

TANTOU INDUSTRIAL ZONZ, SONOCANO, SANONAN TOMAN, NAME DISTRICT, FORMAN SIT

Prepared for : Versare Solutions, LLC

Sample Description : OXFORD PVC
Product specification : 600D PVC

Material : POLYESTER FIBER

The above data and information was / were submitted and identified on behalf of the client .SGS is not responsible for the authenticity, integrity and results of the data and information and / or the validity of the conclusion. results apply to the sample as received.

SGS Ref No. : GZIN2006026663PC

Sample Receiving Date : Jun.08, 2020

Test Performing Date : Jun.08, 2020 to Jun.16, 2020

Test Result Summary

No.	Test(s) Requested	Result(s)	Comments			
1	ISO 5912-2020 Camping tents Clause 6.1.1.3.4 Groundsheet	PASS	/			
For further details, please refer to the following page(s)						

Signed for and on behalf of Shunde Branch SGS-CSTC Co., Ltd.

Daniel Guan Approved signatory





Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions/Terms

| F;| Faulding, European Industrial Part, No.1 Shurfne South Road, Wasta Section, Dalargo Town, Shurde Fosten, Guargotong, Orine 528333 t (868-757)22805888 f (86-757)22805888 www.sgs.group.com.cn
中国・广东・佛山市順徳区大良街道办事处五沙順和南路十号欧洲工业园一号厂房首层 邮编: 528333 t (868-757)22805888 f (868-757)22805888 sgs.china@sgs.com



Test Report

No. SDFS2006003249FF

Date: Jun.16, 2020

Page 2 of 2

Test Conducted:

The test, specified in ISO 5912:2020 Camping tents Clause 6.1.1.3.4 Flammability- Groundsheet, is base on ISO 6925:1982.

I General Information

Materials	Fabric		
Weight	343 g/m²		
Conditioning of Test Specimen	(20±2) °C	RH (65±2) %	24 h
Testing Enclosure (fume cupboard /room)	26.7 °C	RH 64 %	

II Requirement:


When tested in accordance with ISO 6925, the radius of burn shall be less than 35 mm.

III Test Result

Specimen No.	The maximum diameter of damage area (mm)	Whether the flame or glowing reaches the edge of the hole in the metal plate.
1	13	No
2	14	No
3	13	No
4	13	No
5	12	No
6	14	No
7	13	No
8	13	No

Conclusion: PASS

Photo Appendix:

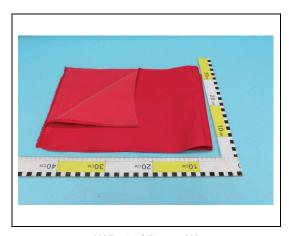

End of Report



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions/Terms

1F;1th Building, European Industrial Park, No. 1. Shurthe South Road, Wustra Section, Dalang Town, Shunde-Fostera, Guangdong, Clina 528333 t (86—757)22805888 f (86—757)22805858 www.sgsgroup.com.cn 中国·广东·佛山市廣德区大良街道办事处五沙颇和南路1号欧洲工业园一号厂房首层邮编: 528333 t (86-757)22805888 f (86-757)22805858 sgs.china@sgs.com